

Work Order ID 86685

July-06-12 11:30:00 AM

86685

Page 1

Item ID: **D2221**

Accept

N900040100

Setup Start ***NS1***

Revision ID:

Stop ***NS2***

Item Name: **350 Basket Base**

Start Date: 7/06/12 Start Qty: 1.00 ***1***

Cust Item ID:

Required Date: 7/06/12 Req'd Qty: 1.00 ***1***

Customer:

Reference:

Approvals: Process Plan: *[Signature]* Date: 12-07-9 Tooling: _____ Date: _____
QC: _____ Date: _____ SPC (Y/N): _____ Date: _____

Run Start ***NR1***

Stop ***NR2***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
Draw Nbr	Revision Nbr								
D2221	Rev H								

100 Large Fab 0.00

110

Large Fab

Large Fab

Memo

0.00

1- assemble all ribs and both D2581 in DT9444 jig, weld as per dwg D2221
2- remove basket from jig and weld D3442-1 shims and D2232-3 hinges as per dwg D2221
3- tack weld mesh on basket as per dwg D2221
A/R ER316 S.S. Rod Batch: 4122357

PLEASE NOTE
IF MAKING -041A OR -043A:
DRILL HOLES FOR GAS SPRING
IN D3825-041 AS PER
DSI 9473

[Signature] 12.12.13

110 QC9- Inspect visual per QSI004- Fusion Welds 0.00

110

QC

Memo

0.00

Quality Control

DAS
24
8-83 12.12.14

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Work Order ID 86685

86685

Page 2

July-06-12 11:30:00 AM

Item ID: D2221 Accept *N900040100* Setup Start *NS1*
 Revision ID: Stop *NS2*
 Item Name: 350 Basket Base
 Start Date: 7/06/12 Start Qty: 1.00 *1* Cust Item ID:
 Required Date: 7/06/12 Req'd Qty: 1.00 *1* Customer:
 Reference:

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____ Run Start *NR1*
 QC: _____ Date: _____ SPC (Y/N): _____ Date: _____ Stop *NR2*

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
120	QC6- Inspect dimensions to drawing	0.00							
120									
QC	Memo	0.00							
Quality Control									
125	Pressure Wash per QSI005 4.3	0.00							
125									
HandFinish	Memo	0.00							
Hand Finishing									

DAS
24
8-83

12.12.14

1x

IX

MA
12/12/17

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Work Order ID 86685

86685

Page 3

July-06-12 11:30:00 AM

Item ID: D2221 Accept *N9000040100* Setup Start *NS1*
 Revision ID: Stop *NS2*
 Item Name: 350 Basket Base
 Start Date: 7/06/12 Start Qty: 1.00 *1* Cust Item ID:
 Required Date: 7/06/12 Req'd Qty: 1.00 *1* Customer:
 Reference:

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____ Run Start *NR1*
 QC: _____ Date: _____ SPC (Y/N): _____ Date: _____ Stop *NR2*

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
130	White Gloss(Ref:4.3.5.2) per QSI005 4.3-Steel	0.00							
130									
Powdercoat	Memo	0.00							
Powder Coating	1- Plug holes prior to								
	1ST COAT: 1-30								
	START TIME: 400 OF								
	OVEN TEMPERATURE:								
	FINISH TIME: 2-30								
	***** 2nd coat if necessary*****								
	2ND COAT:								
	START TIME:								
	OVEN TEMPERATURE:								
	FINISH TIME:								
140	QC3- Inspect Part Finish	0.00							
140									
QC	Memo	0.00							
Quality Control									

m123383

1X

12/12/17

1 0 12-12-18



Dart Aerospace Ltd

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Work Order ID 86685

86685

Page 4

July-06-12 11:30:00 AM

Item ID: D2221 Accept *N900040100* Setup Start *NS1*
 Revision ID: Stop *NS2*
 Item Name: 350 Basket Base
 Start Date: 7/06/12 Start Qty: 1.00 *1* Cust Item ID:
 Required Date: 7/06/12 Req'd Qty: 1.00 *1* Customer:
 Reference:

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____ Run Start *NR1*
 QC: _____ Date: _____ SPC (Y/N): _____ Date: _____ Stop *NR2*

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
150 *150* Packaging Packaging	Identify as per dwg & Stock Location: <u>D.350-607-041A</u> Memo	0.00	86587			1	φ	AR 12-12-18	
160 *160* QC Quality Control	QC21- Final Inspection - Work Order Release Memo	0.00						12/12/18	

12-18-12

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Picklist Print

July-06-12 11:29:58 AM

Page 1

Work Order ID: 86685
 Parent Item: D2221
 Parent Item Name: 350 Basket Base

Start Date: 7/06/12

Required Date: 7/06/12

Start Qty: 1.00

Required Qty: 1.00

Comments: IPP Rev:J 05.09.02 Added D3442-1 KJ/JLM
 IPP Rev:K 08-08-29 revG as per dwg DD verified by:EC
 IPP Rev:L 08-09-24 plug holes prior to powder coat DD verified by:EC
 IPP Rev:M 08-12-02 revH as per dwg DD verified by:EC IPP Rev:N 10.06.29 added pressure
 wash DD verf:EC

Component Item ID/ Item Name	Replacement Item ID	Mfg/ Purch	Bin Item	Primary Location	Last Location	Route Seq ID	Unit of Measure	Qty on Hand	Qty per Kit	Total Qty	Qty Issued	Date Issued	Status
D2221-1 Rib		Manufactured	No			100	Each	8.0000	1	1		12.12.07	
				<u>Location</u>		<u>Loc Qty</u>		<u>Loc Code</u>					
				WA		8							
				83907		8							
D2221-5 Rib		Manufactured	No			100	Each	21.0000	2	2		12.12.07	
				<u>Location</u>		<u>Loc Qty</u>		<u>Loc Code</u>					
				WA		19							
				83914		4							
				84793		15							
				WA006		2							
				67117		2							
D2221-7 Rib		Manufactured	No			100	Each	7.0000	1	1		12.12.07	
				<u>Location</u>		<u>Loc Qty</u>		<u>Loc Code</u>					
				WA		5							
				84762		5							
				WA006		2							
				81041		2							

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Picklist Print

July-06-12 11:29:59 AM

Page 2

Work Order ID: 86685

Parent Item: D2221

Parent Item Name: 350 Basket Base

Start Date: 7/06/12

Required Date: 7/06/12

Start Qty: 1.00

Required Qty: 1.00

D2232-3
Basket Hinge

Manufactured No 100 Each 27.0000

²
~~B86362~~ → 2x *dy* 12.12.07

<u>Location</u>	<u>Loc Qty</u>	<u>Loc Code</u>
WA	25	
82304	3	
85698	10	
86362	12	
WA005	2	
75581	2	

D2235-1
Basket Rib

Manufactured No 100 Each 20.0000

²
~~B88574~~ → 2x *dy* 12.12.07
~~B89964~~ → 2x

<u>Location</u>	<u>Loc Qty</u>	<u>Loc Code</u>
WA	16	
78636	5	
81910	1	
85602	4	
86051	6	
WA005	4	
66895	4	

D2531
Mounting Bracket

Manufactured No 100 Each 59.0000

²
~~B88574~~ → 2x *dy* 12.12.07

<u>Location</u>	<u>Loc Qty</u>	<u>Loc Code</u>
WA	37	
82506	2	
83230	3	
85436	8	
85452	24	
WA005	22	
70766	2	
81253	1	
82897	19	

July-06-12 11:29:59 AM

Shop Packet Print

Page 2

Dart Aerospace Ltd

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Picklist Print

July-06-12 11:29:59 AM

Page 3

Work Order ID: 86685

Parent Item: D2221

Parent Item Name: 350 Basket Base

Start Date: 7/06/12

Required Date: 7/06/12

Start Qty: 1.00

Required Qty: 1.00

D3442-1

Shim

Manufactured No

100 Each 17.0000

B 90017 → 2x 12.12.07

Location

Loc Qty

Loc Code

WA

17

80788

17

D3825-041

Rib Assembly (Basket End)

Manufactured No

100 Each 10.0000

B 89449 → 2x 12.12.07

Location

Loc Qty

Loc Code

WA

10

83912

4

83913

6

D3826-041

Rib /Gusset Assembly

Manufactured No

100 Each 6.0000

B 88280 → 2x 12.12.07

Location

Loc Qty

Loc Code

WA

6

81571

6

D3827-041

Rib Assembly (Inboard)

Manufactured No

100 Each 11.0000

B 87589 12.12.07

Location

Loc Qty

Loc Code

WA

5

81038

5

WA006

6

72729

1

84792

5

D3832-0

Mesh (Base)

Manufactured No

100 Each 3.0000

B 87148 12.12.07

Location

Loc Qty

Loc Code

WA

3

85175

3

July-06-12 11:29:59 AM

Shop Packet Print

Page 3

Dart Aerospace Ltd

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____
 Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Picklist Print

July-06-12 11:29:59 AM

Page 4

Work Order ID: 86685

Parent Item: D2221

Parent Item Name: 350 Basket Base

Start Date: 7/06/12

Required Date: 7/06/12

Start Qty: 1.00

Required Qty: 1.00

D3833-1

Manufactured No

100 Each 24.0000

Mesh (Base End Face)

Location

Loc Qty

Loc Code

WA	12	
77521	4	
86314	8	
WA035	12	
81259	1	
85697	11	

B897/66 → 21

10/12/11

July-06-12 11:29:59 AM

Shop Packet Print

Page 4


W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

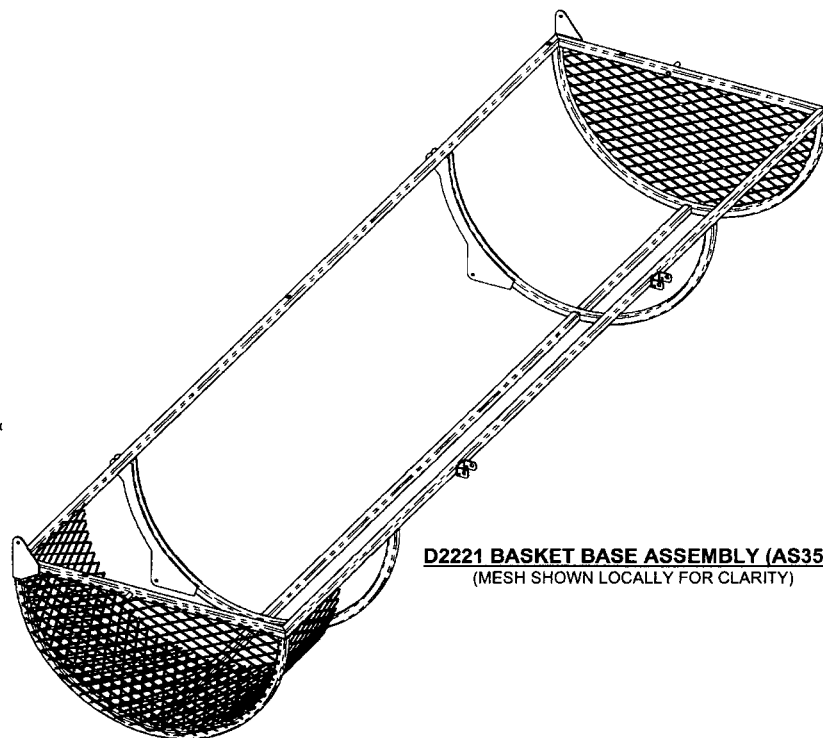

D2221 BASKET BASE ASSEMBLY (AS350)
(MESH SHOWN LOCALLY FOR CLARITY)

SHOP COPY
RETURN TO
ENGINEERING
UNCONTROLLED COPY
SUBJECT TO AMENDMENT
WITHOUT NOTICE
WORK ORDER
NO. 86685

12-07-9

ITEM	QTY	P/N	DESCRIPTION
1	X	D2221	BASKET BASE ASSEMBLY (AS350)
2	1	D2221-1	RIB
3	2	D2221-5	RIB
4	1	D2221-7	RIB
5	2	D2232-3	BASKET HINGE
6	2	D2235-1	RIB
7	2	D2581	MOUNTING BRACKET
8	2	D3442-1	SHIM
9	2	D3825-041	RIB ASSY (BASKET END)
10	2	D3826-041	RIB/GUSSET ASSY
11	1	D3827-041	RIB ASSY (INBOARD)
12	2	D3833-1	MESH, BASE END FACE
13	1	D3832-1	MESH (BASE)

RECEIVED
08/11/94

NOTES:

- 1) MATERIAL: N/A
- 2) FINISH: POWDER COAT GLOSS WHITE (4.3.5.2) PER DART QSI 005 4.3
- 3) TOLERANCES: PER DART QSI 018 UNLESS OTHERWISE NOTED
- 4) UNITS: INCHES UNLESS OTHERWISE NOTED
- 5) BREAK SHARP EDGES: 0.005 TO 0.010 MAX
- 6) IDENTIFICATION: N/A
- 7) WEIGHT: 42.00 lbs APPROX
- 8) MASK ALL HOLES PRIOR TO POWDER COATING

H	REVISED PARTS LIST AND ADDED "ITEM" COLUMN TO PARTS LIST (ZN D3-1); REVISED SECTIONS A-A, B-B AND C-C (ZN C6-3, C2-3 AND A6-3); REVISED DETAIL D (ZN B7-4); ADDED DETAIL E (ZN A6-4); ADDED SECTION F-F (ZN B2-4); ADDED DWG DETAILS FOR D2221-1/-5/-7 (SHEET 5); TOL REVISED TO 2 DEC PLACES (ZN D8-3 AND ZN B4-3); D3825-041 REPLACES D2221-3/D2327-3; D3826-041 REPLACES D2235-1/D2325; D3827-041 REPLACES D2221-1 ON INBOARD SIDE; ADDED D3832-1 AND D3833-1. REASON: SATISFY "LEAN MANUFACTURING" PROGRAM.	MB	08.09.18
G	MATERIAL FOR -1, -3, -5 & -7 WAS 0.060 WALL. TOLERANCE FOR 96.00 DIM WAS +/- 0.01 AND 56.00 DIM WAS REF (ZN B5-2); 19.62 DIM WAS "HARD" DIMENSION IS NOW "REF" (ZN B4-2); NOTE 5 TRANSFERRED FROM SHT 1 TO SHT 2. SHT 2 MESH MATERIAL UPDATED; DRAWING TRANSFERRED TO "B" FORMAT	AJS	08.06.16
F	ADD SHIM UNDER HINGE; ADD HOLES FOR SPLIT LID BASKET	PH	05.06.07
E	CHANGE HINGE	CP	01.04.19
D	CHANGE LATCH	BW	96.06.21
C	SEPARATE BASKET AND LID	KH	95.11.21
REV	DESCRIPTION	BY	DATE
DESIGN	BW	DART AEROSPACE LTD HAWKESBURY, ONTARIO, CANADA	
DRAWN	BW		
CHECKED	BW	DRAWING NO	REV. H
MFG. APPR.	BW	D2221	SHEET 1 OF 5
APPROVED	BW	TITLE	SCALE
DE APPR.	BW	BASKET BASE ASSEMBLY (350)	NTS
DATE	08.09.18	COPYRIGHT © 1994 BY DART AEROSPACE LTD <small>"THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL UNLESS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD"</small>	



Dart Aerospace Ltd

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____
 Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

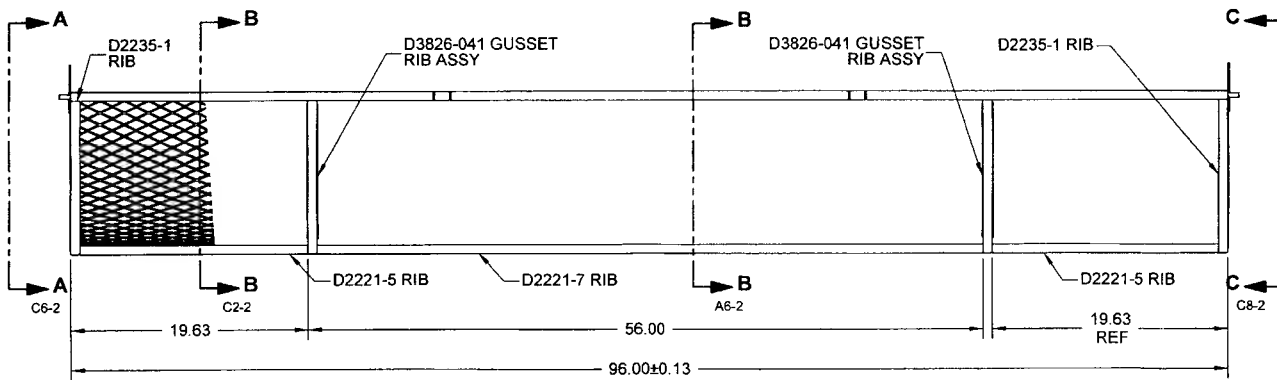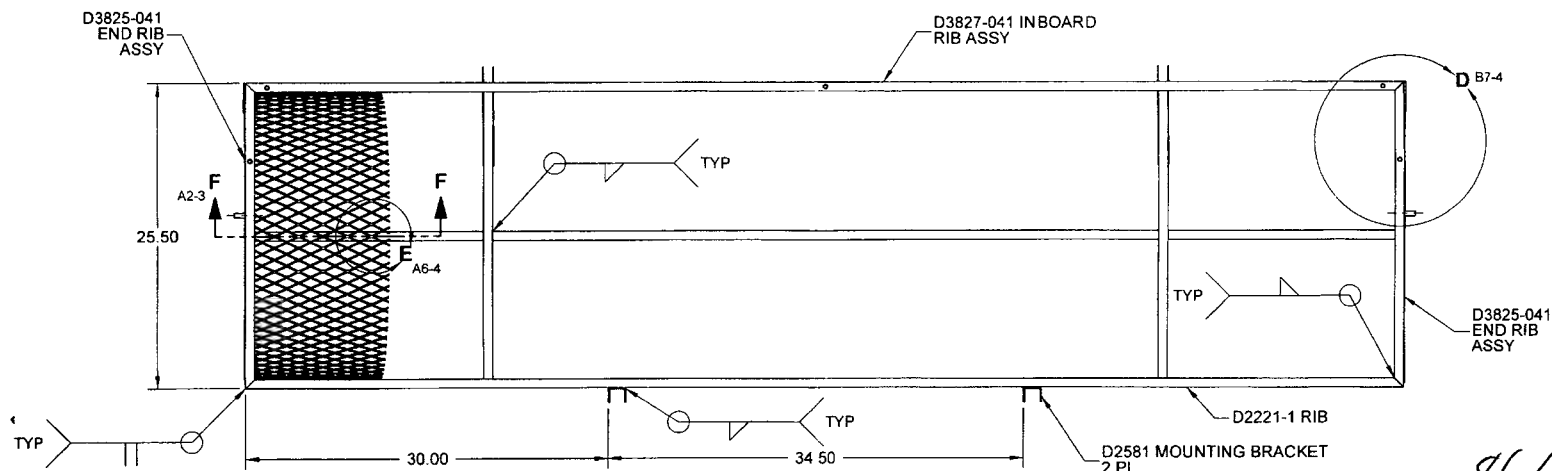

D2221 BASKET BASE ASSEMBLY (350)
(MESH SHOWN LOCALLY FOR CLARITY)

RELEASED
06/11/18 NAD

DESIGN	BW	DART AEROSPACE LTD	
DRAWN		HAWKESBURY, ONTARIO, CANADA	
CHECKED		DRAWING NO.	REV. H
MFG. APPR.		D2221	SHEET 2 OF 5
APPROVED		TITLE	SCALE
DE APPR.		BASKET BASE ASSEMBLY (350)	NTS
DATE	08.09.18	COPYRIGHT © 1994 BY DART AEROSPACE LTD	
THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL. IT IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.			


Dart Aerospace Ltd

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____
 Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

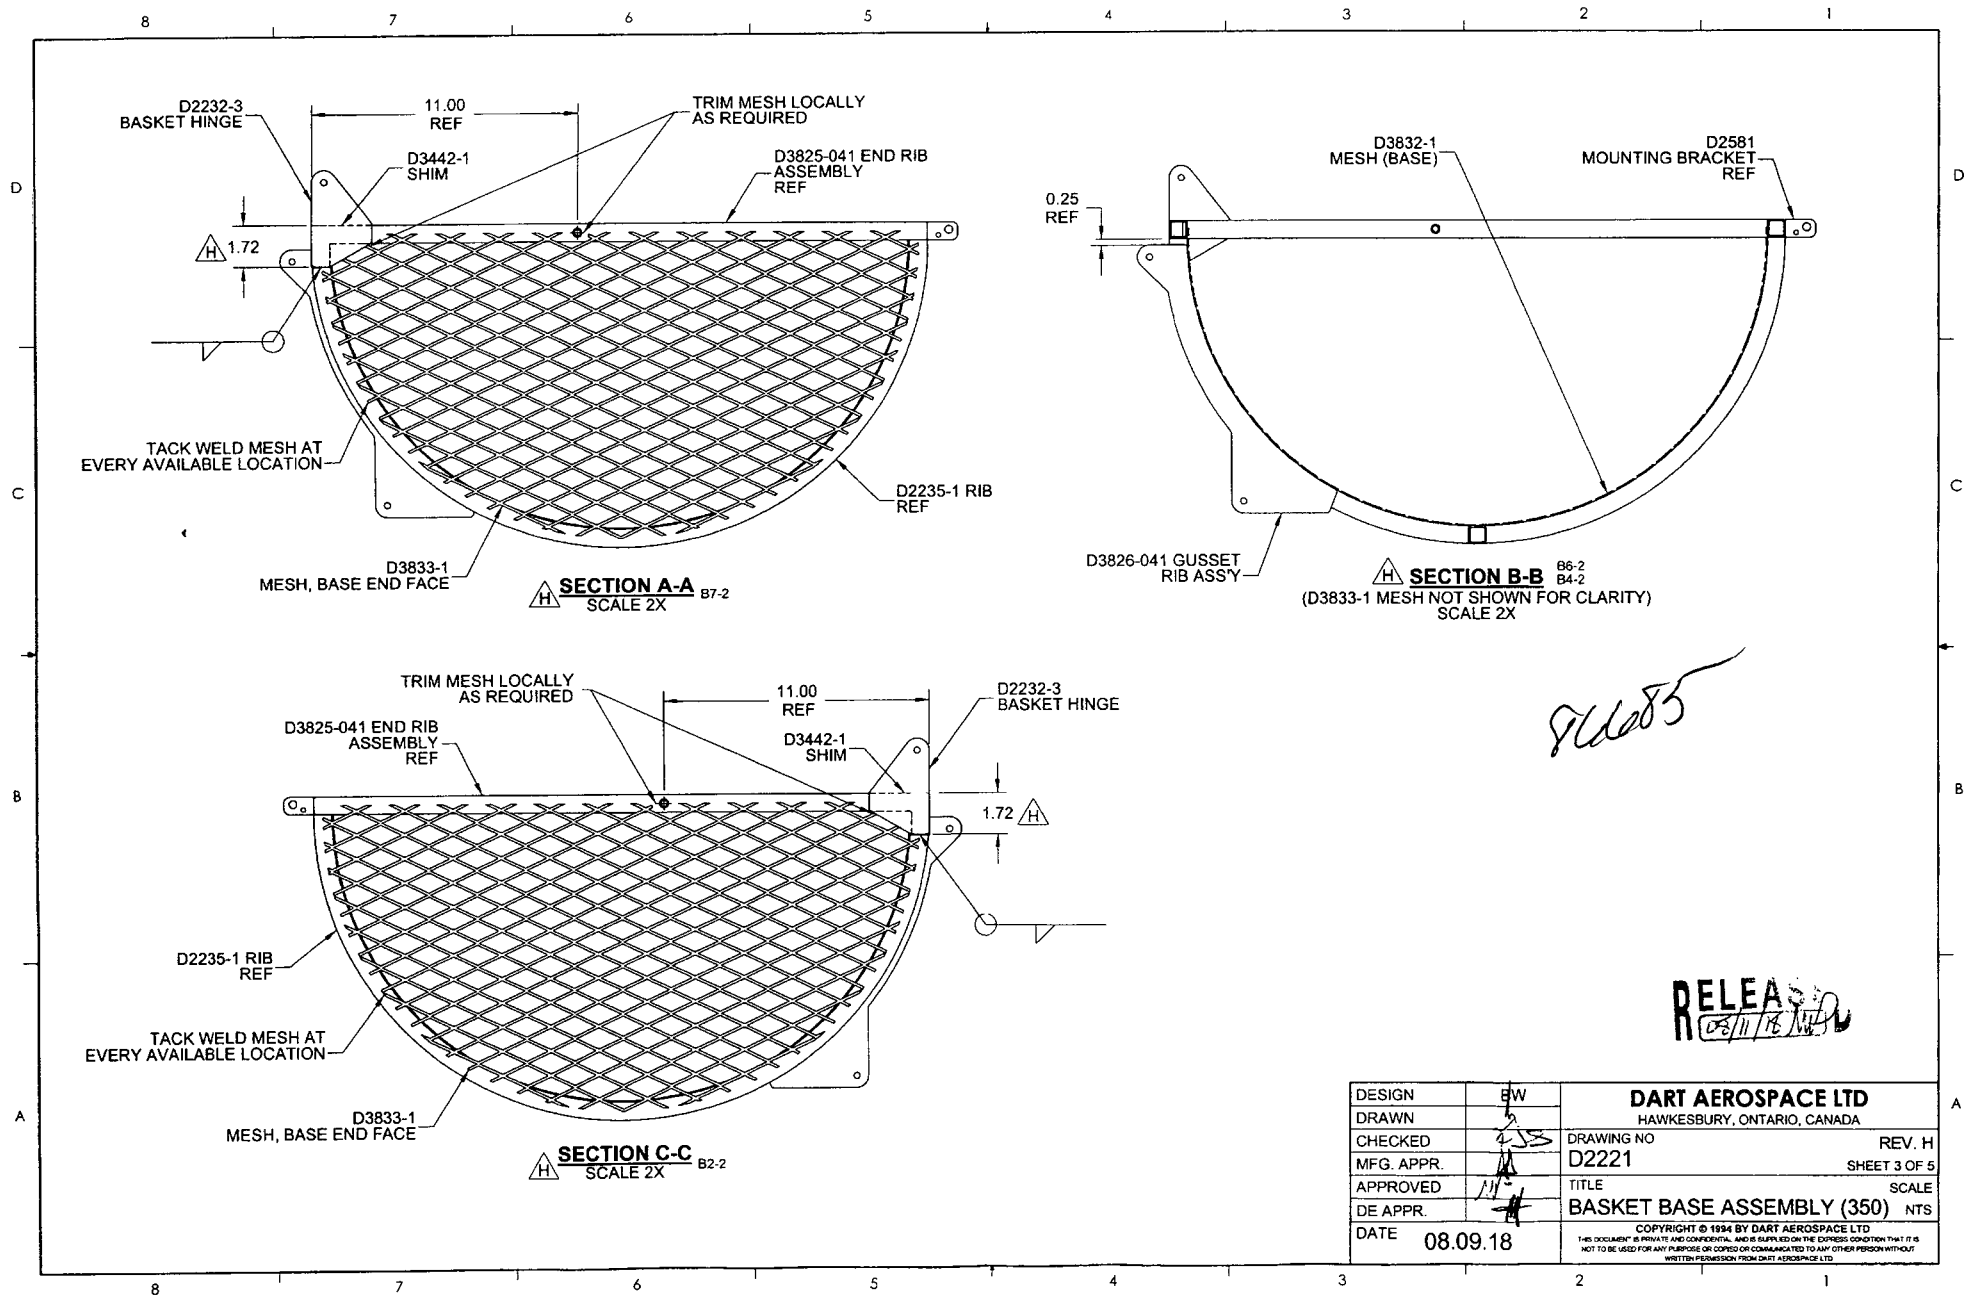

Dart Aerospace Ltd

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries


8 7 6 5 4 3 2 1

D


C

B


A

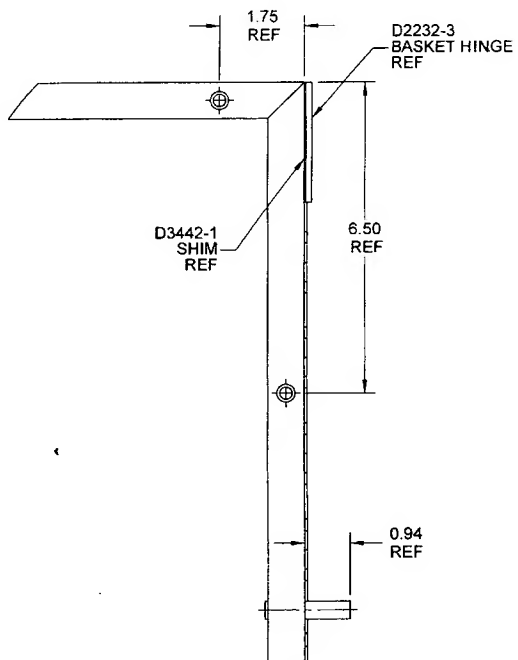

DETAIL D
SCALE 4X D2-2

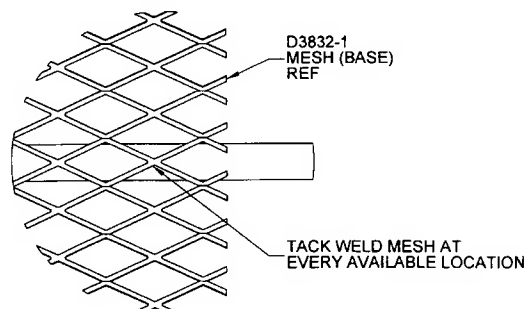

DETAIL E
SCALE 4X C6-2

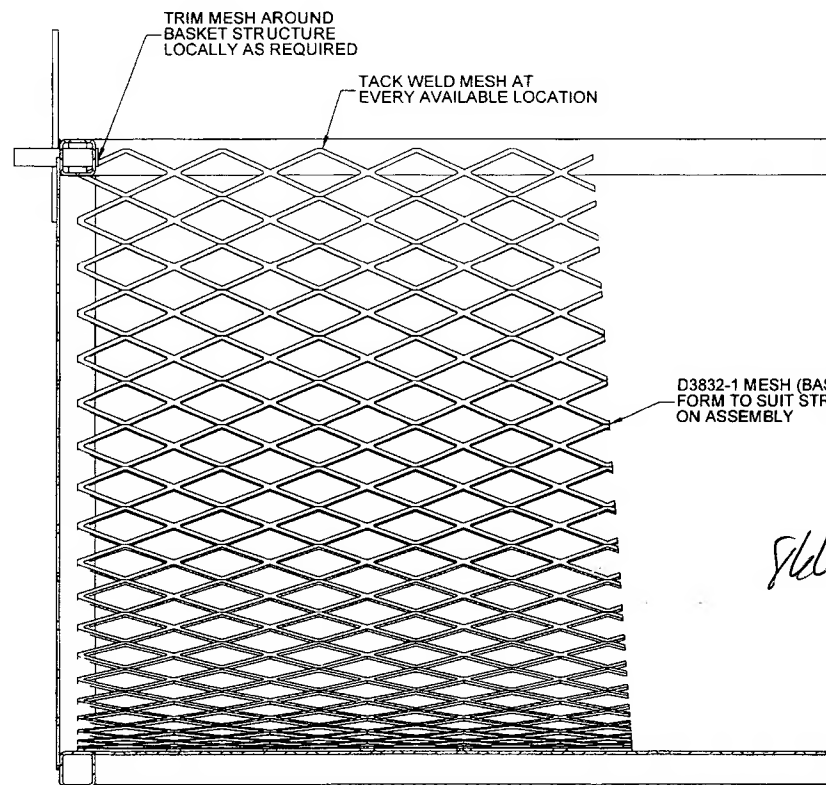

SECTION F-F
SCALE 4X D7-2

RELEASED
08/11/18

DESIGN	BW	DART AEROSPACE LTD	
DRAWN		HAWKESBURY, ONTARIO, CANADA	
CHECKED	<i>[Signature]</i>	DRAWING NO. D2221	REV. H
MFG. APPR.	<i>[Signature]</i>	SHEET 4 OF 5	
APPROVED	<i>[Signature]</i>	TITLE	SCALE
DE APPR.	<i>[Signature]</i>	BASKET BASE ASSEMBLY (350) NTS	
DATE	08.09.18	COPYRIGHT © 1994 BY DART AEROSPACE LTD	
THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.			

8 7 6 5 4 3 2 1




Dart Aerospace Ltd

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector


Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____
 Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

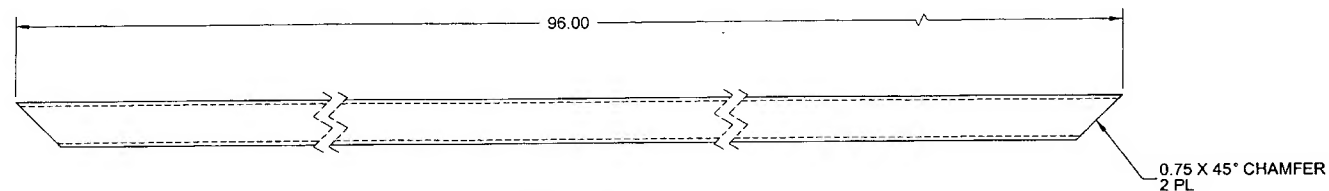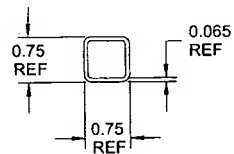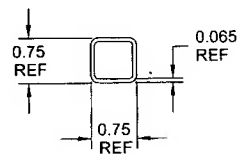

D2221-1 RIB

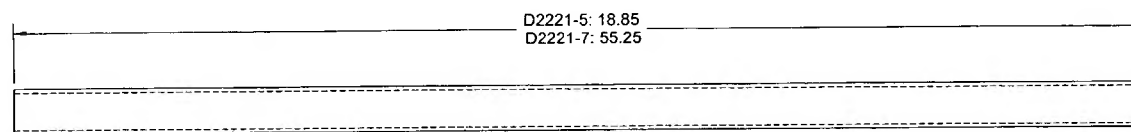

D2221-5/-7 RIB

56185

RELEASED
08/11/18

- NOTES:**
- 1) MATERIAL: AISI 304/316 STAINLESS STEEL SQUARE TUBE, 0.75 X 0.75 X 0.065 WALL
REF. DART SPEC. M304TS0.750W0.065
 - 2) FINISH: NONE
 - 3) TOLERANCES: PER DART QSI 018 UNLESS OTHERWISE NOTED
 - 4) UNITS: INCHES UNLESS OTHERWISE NOTED
 - 5) BREAK SHARP EDGES: 0.005 TO 0.010 MAX
 - 6) IDENTIFICATION: N/A
 - 8) WEIGHT: D2221 -1 = 4.57 lbs; D2221-5 = 0.90 lbs; D2221-7 2.65 = lbs

DESIGN	BW	DART AEROSPACE LTD	
DRAWN		HAWKESBURY, ONTARIO, CANADA	
CHECKED		DRAWING NO. D2221	REV. H
MFG. APPR.		SHEET 5 OF 5	
APPROVED		TITLE	SCALE
DE APPR.		BASKET BASE ASSEMBLY (350) NTS	
DATE	08.09.18	<small>COPYRIGHT © 1994 BY DART AEROSPACE LTD THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR DISCLOSED OR REPRODUCED IN ANY MANNER WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.</small>	

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries